

DAWN ENTERPRISES INC.

9155 Sweet Valley Dr., Valley View, OH 44125
Phone: (216) 447-1777 or (800) 548-4867
Fax: (216) 642-5505
www.dawn-ent.com


INSTALLATION INSTRUCTIONS

PART NUMBER: LCM-VERANO12-26-5-6
FOR: 2012 Buick Verano
EFFECTIVE: 15 June 2015

PLEASE READ ALL INSTRUCTIONS BEFORE BEGINNING INSTALLATION

1. **LOCATION** (See Diagram below):

Run masking tape, **as shown using the measurements in the diagram below**, from POINT A to POINT B. Press tape against the vehicle, making sure that the tape is straight from POINT A to POINT B.

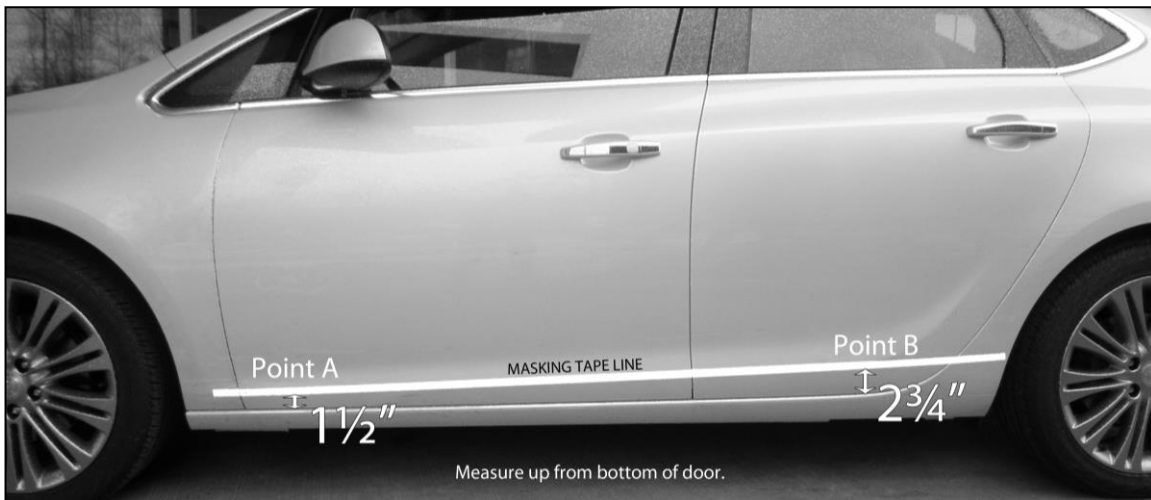

2. **CLEAN AND PREP:**

For proper installation of the molding, clean the surface where the molding is to be installed using the provided alcohol pads. Wipe off excess residue with a clean cloth. Next, apply **PRO-BOND ADHESIVE PROMOTER** in the crush swab self-applicator. Squeeze the applicator until you feel the applicator "crush". The applicator will become wet on the end when it is ready for use. Apply a thin coat of **PRO-BOND** below the masking tape line, only in the area the molding will cover (see Diagram C). Do not apply **PRO-BOND** in any area that the molding will not cover, as **PRO-BOND** could dull the paint surface. The light coat of **PRO-BOND** will dry quickly. Where cooler temperatures prevail, make sure the molding is at room temperature. The recommended metal surface temperature of the vehicle should be at least 75°F/24°C for proper installation. If the surface is cold, use a heat gun or hair dryer to warm before proceeding with installation.

DIAGRAM B (STARTING POINT)

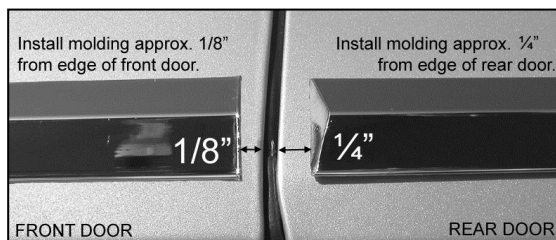


DIAGRAM C (FINISHED INSTALLATION)



3. **INSTALLATION (IMPORTANT):**

Before starting, see Diagram B as to where to start applying molding. Next, completely peel off all of the liner from back of molding, making sure all red liner is removed from molding. **DO NOT TOUCH** the exposed adhesive with your fingers as you install the molding.

4. See Diagram C for final installation.

5. **AFTER THE MOLDING** has been installed, use a soft cloth to apply pressure along the entire length of the molding to insure proper adhesion.